

Work Order ID 81481

81481

Page 1

Mark 14-12 3:38:25 PM

Item ID: D407-667-205

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Aft

Stop ***NS2***

Start Date: 14/03/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/03/14 Tooling:

Date:

Run Start ***NR1***

QC:

Date: SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D407-667-245

Rev F/DEO

100

0.00

100

DOCUMENT CONTROL SB

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D407-667-205-CHG007

CHG008

5/2/04/03

AGMLS 12-4-3

110

0.00

110

Pick Kit

Packaging

Packaging

Memo

0.00

Packaging

TW

12-3-20

120

0.00

120

BENDING MACHINE - CROSSTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

1-Bend tube as per Dwg D407-667-245 using CNC bender program 407 Aft and Folio 21

TW
Ry

12-3-20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 81481

March-14-12 3:38:25 PM

81481

Page 2

Item ID: D407-667-205

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Aft

Start Date: 14/03/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

QC15- Crosstube Dimensional Check

0.00

130

QC

Memo

0.00

Quality Control

CP 12.03.20

1 /

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 81481

March-14-12 3:38:25 PM

81481

Page 3

Item ID: D407-667-205

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Aft

Start Date: 14/03/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

0.00

140

Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D407-667-245 Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D407-667-245

6-Drill Aft rivet holes using drill Jig DT8789 as per Dwg D407-667-245. Note: Aft side has 3x top holes.

7-Drill Fwd rivet holes using drill Jig DT8789 as per Dwg D407-667-245. Drill only the top (3) holes.

8-C'sink holes as per Dwg D407-667-245. Allow rivet to sit below surface to compensate for paint.

9- Scribe tube to identify on the inner chamfer in the cuff D# and B#

10-Deburr & Inspect for surface damage. Repair damage within limits as per

MO

12/3/21

MO

12/3/21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

March-14-12 3:38:25 PM

Page 4

0.00

MO

12/3/21



12-3-22

2

12-3-22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 81481

March-14-12 3:38:25 PM

81481

Page 6

Item ID: D407-667-205

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Aft

Start Date: 14/03/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	SprayPaint	0.00							
210									
SprayPaint	Memo	0.00							
Spray Painting	***Mask underside of crosstube as shown***								
	1-Prime inside and outside crosstube as per DEO D407-667-245 and QSI 005 4.2								
	2-Paint outside crosstube with White Imron as per QSI 005 4.2								
	PRIME:								
	Start Time: <u>9:45</u>								
	Finish Time: <u>10:45</u>								
	PAINT:								
	Start Time: <u>11:00</u>								
	Finish Time: <u>12:00</u>								
220	QC14- Inspect Spray Paint	0.00							
220									
QC	Memo	0.00							
Quality Control	Then, Wrap in plastic bag to protect from scratches								

Ag 12 - 3 - 27

Ag 12 03 28 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

81481

Page 7

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 14/03/2012 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 03/04/2012 **Req'd Qty:** 1.00 *** 1 ***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____ **Run** **Start** ***NR1***
 QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____ **Stop** ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

0.00

230

Crosstubes

0.00

Crosstubes

Crosstubes

Memo

1- Install chafing shield as per DEO D407-667-245. Top holes should be facing up.

A/R Proseal 890 Batch: 120867
EXP: 11/12

2- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

3-Install support with Scotch-Weld DP460 and install clamps as per DEO Dwg D407-667-245 using installaiton jig DT9025. Torque clamps as per dwg

A/R Scotch-Weld DP460 Batch: 120398
EXP: 14 Mar 2013

4-Install nut plates as per Dwg D407-667-245. Touch-up rivet heads with Imron paint.

QC5- Inspect part completeness to step on W/O	0.00
---	------

240

QC

Memo

0.00

Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 81481

81481

Page 8

March-14-12 3:38:25 PM

Item ID: D407-667-205

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Aft

Stop ***NS2***

Start Date: 14/03/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	Pick Kit	0.00							
250									
Packaging	Memo	0.00							
Packaging									
260	QC4- 100% Inspect kits for completeness	0.00							
260									
QC	Memo	0.00							
Quality Control									
270	Packaging	0.00							
270									
Packaging	Memo	0.00							
Packaging	Identify and in kanban rack Location: _____								

Rev G

12/04/03

5/2/03

1x SP 12-04-04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 81481***81481***

Page 9

March-14-12 3:38:25 PM

Item ID: D407-667-205

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Aft

Stop ***NS2***

Start Date: 14/03/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

280

QC21- Final Inspection - Work Order Release

0.00

280

QC

Memo

0.00

Quality Control

P12-07-4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

March-14-12 3:38:28 PM

Page 1

Work Order ID: 81481

81481

Parent Item: D407-667-205

D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 14/03/2012

Required Date: 03/04/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:C 05.09.02 Add holes for compatibility with Bell SkidtubesKJ/JLM
IPP Rev:D Added Magnobond,Rubber Cushion & Clamps 07-02-19
JLM

****CHANGE TO CHG 005 - IF USING D2894-1 B35578 OR GREATER****

IPP Rev:E 08-05-22 add comment in seq. 6 and QC15 and QC5 DD verified by:EC

IPP Rev:F 08-06-12 add comment in seq. 24 DD verified by:EC

IPP Rev:G 08-08-19 revE as per dwg DD verified by:EC

IPP Rev H 09.01.06 ECN 08-562 EC verified by:DD IPP Rev:I

10.04.07 revise route seq. in bom DD verified by:JLM IPP Rev J 11.04.26

removed abrasion strip ecn 11-551 EC verified

by:DD

IPP REV:K

11.10.03 DEO D407-667-245-F-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D407-667-205TRN		Manufactured	No		B79745	110	Each	0.0000	1	1	JW	12-3-20	
D407-667-205TRN									**				
Crosstube Turning Detail													
AN960JD516	NAS1149D0563J	Purchased	No			230	Each	0.0000	18	18	✓		
AN960.ID516									**				
Washer													
D2873-043		Manufactured	No			230	Each	24.0000	2	2	119 717 AS	12-3-30	
D2873-043									**				
Nut Plate Assembly													

Location

Loc Qty

Loc Code

LG

2

79395

2

LG052

22

72644

2

80228

20

2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

March-14-12 3:38:29 PM

Page 2

Work Order ID: 81481

81481

Parent Item: D407-667-205

D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 14/03/2012

Required Date: 03/04/2012

Start Qty: 1.00

Required Qty: 1.00

D2873-045

Manufactured No

230

Each

17.0000

2

2

D2873-045

Nut Plate Assembly

**

AP 12-3-30

Location

Loc Qty

Loc Code

LG052

17

80162

17

2

D2894-1

Manufactured No

230

Each

1.0000

1

1

D2894-1

2.750 Support

**

AP 12-3-30

75212

Location

Loc Qty

Loc Code

LG052

1

74464

1

1

D3190-1

Manufactured No

230

Each

53.0000

2

2

D3190-1

Chafing Shield

**

AP 12-3-30

Location

Loc Qty

Loc Code

LG053

23

75947

23

LG055

30

12576

30

2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

March-14-12 3:38:29 PM

Page 3

Work Order ID: 81481

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft

81481

D407-667-205

Start Date: 14/03/2012

Required Date: 03/04/2012

Start Qty: 1.00

Required Qty: 1.00

D3595-063-450

Manufactured No

230

Each

134.1095

2

2

D3595-063-450

RUBBER CUSHION

**

AS 12-3-30

Location

Loc Qty

Loc Code

LG051

88

80161

88

MAT052

46.109474

67353

2

68893

6

70113

0.56

71354

0.2

74113

0.349474

75597

1

77678

36

MS20601-AD4W8

Purchased

No

230

Each

190.0000

14

14

MS20601-AD4W8

RIVET

**

AS 12-3-30

Location

Loc Qty

Loc Code

LG051

190

121017

190

MS21920-22

Purchased

No

230

Each

88.0000

4

4

MS21920-22

Clamp(per MIL-DTL-8783C)

**

AS 12-3-30

Location

Loc Qty

Loc Code

LG

22

119545

22

LG050

66

116207

7

117506

1

118186

8

120631

50

March-14-12 3:38:29 PM

Shop Packet Print

Page 3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

March-14-12 3:38:29 PM

Page 4

Work Order ID: 81481

Parent Item: D407-667-205

Parent Item Name: Crosstube Aft

81481

D407-667-205

Start Date: 14/03/2012

Required Date: 03/04/2012

Start Qty: 1.00

Required Qty: 1.00

MS21920-25

Purchased

No

230

Each

165.0000

2

2

MS21920-25

Clamp(per MIL-DTL-8783C)

**



AR 12-3-30

Location

Loc Qty

Loc Code

LG050

165

116264

2

117998

4

118142

4

119339

2

119746

2

120054

1

120475

50

120920

100

2

AN5-10A

Purchased

No

250

Each

394.0000

10

10

AN5-10A

Bolt

**



JB

Location

Loc Qty

Loc Code

ST337

394

118191

80

120630

50

120717

50

120770

214

120770

4

AN5-32A

Purchased

No

250

Each

256.0000

4

4

AN5-32A

Bolt

**



JB 12/04/03

Location

Loc Qty

Loc Code

ST339

256

119328

100

119862

50

120423

75

120717

1

120910

30

119328

March-14-12 3:38:29 PM

Shop Packet Print

Page 4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

March-14-12 3:38:29 PM

Page 5

Work Order ID: 81481

81481

Parent Item: D407-667-205

D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 14/03/2012

Required Date: 03/04/2012

Start Qty: 1.00

Required Qty: 1.00

AN5-34A

Purchased

No

250

Each

78.0000

4 7 4 ✓

AN5-34A
Bolt

**

JB SP

Location

Loc Qty

Loc Code

ST339

78

119328

28

120422

50

119328

MS21042L5

Purchased

No

250

Each

1,602.000

4 1 4 ✓

MS21042L5
Nut

**

JB SP

Location

Loc Qty

Loc Code

ST300

1602

116105

5

116548

43

117611

42

118179

12

119109

1500

119109

12/04/03

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	81481
Description: Crosstube High Aft (407)		Part Number:	D407-667-205
Inspection Dwg: D407-667-245 Rev: F		Page 1 of 1	

Required Dimension	Min	Max
Height	23.39	23.65
1/2 Span	45.79	46.05
Angle	54	56
Total Span	91.58	92.100

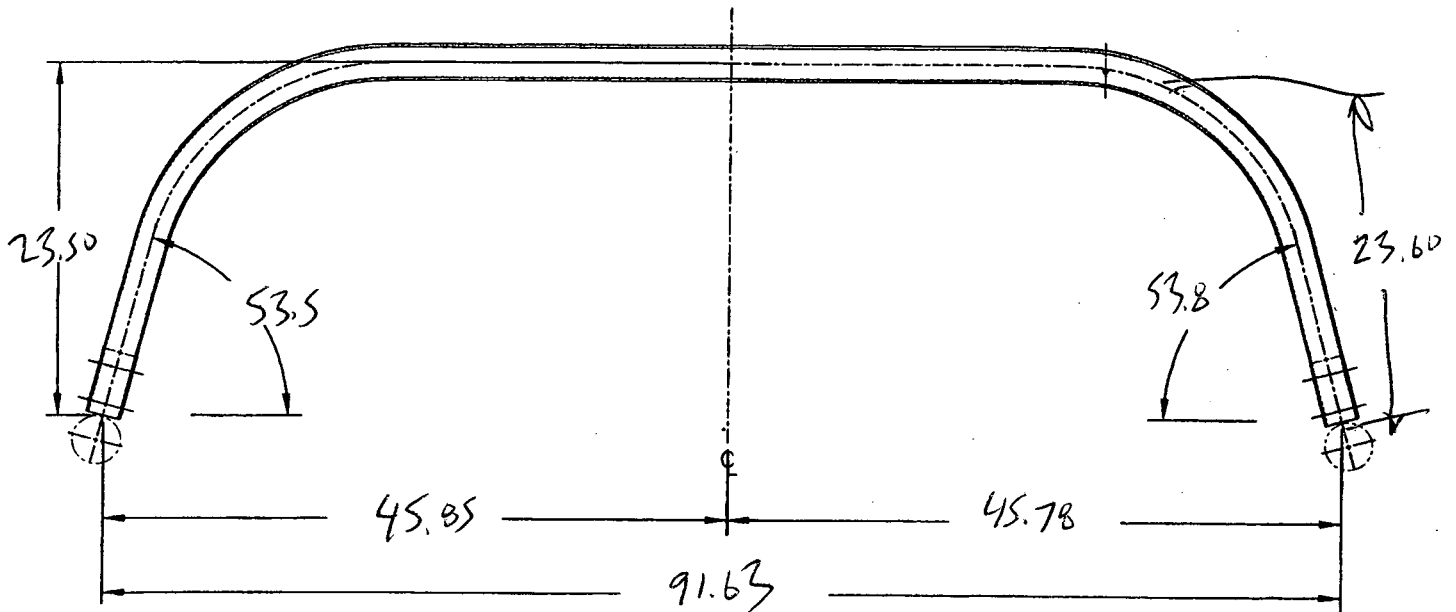

	A	Comments	B
CRUSHING	5.1%		4.8%
# PASSES	32		32
ANGLES/WIDTH UNDER TOL.			
OK CP 12.03.20 P51642			

QC15 Inspection	CP
Date	12.03.20

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	09.06.22	Dwg Rev updated	KJ	
C	11.08.22	Dimensions updated	KJ	
D	11.09.30	Dimensions updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	QTY -245	PART NUMBER	DESCRIPTION
1	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
2	1	D6011-115	CROSSTUBE
3	2	D2856-400-773	ABRASION STRIP
4	2	D2873-043	NUT PLATE
5	2	D2873-045	NUT PLATE
6	1	D2894-1	SUPPORT
7	2	D3190-1	CHAFING SHIELD
8	2	D3595-063-430	RUBBER CUSHION
9	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
10	4	MS21920-22	CLAMP
11	2	MS21920-25	CLAMP (OR MS21920-24)
12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER

NO. 81481 MCT

12/03/14

@DEO ATTACHED

RELEASED
08/11/12

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 27.7 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND
6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO
PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE
SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS.
ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF
CROSSTUBE, PER QSI 035.
- 16) INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE
OPPOSITE D2894-1 SUPPORT.
- 17) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	qf	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. REV. F D407-667-245 SHEET 1 OF 4 TITLE SCALE CROSSTUBE ASS'Y (407 HIGH AFT) NTS <small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	
DRAWN	RF		
CHECKED	qf		
MFG. APPR.	qf		
APPROVED	qf		
DE APPR.	qf		
DATE	08.11.06		



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

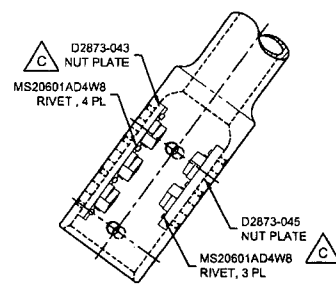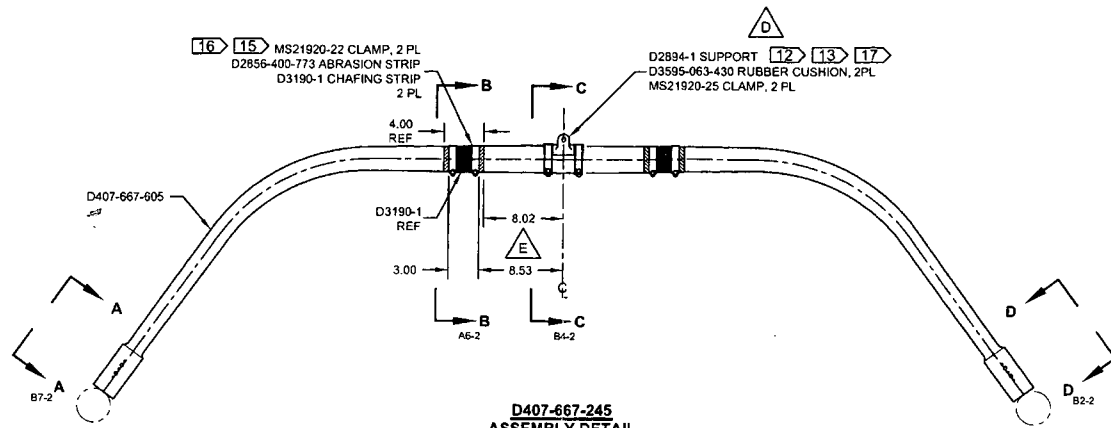


VIEW A-A CUFF DETAIL
SCALE 4X

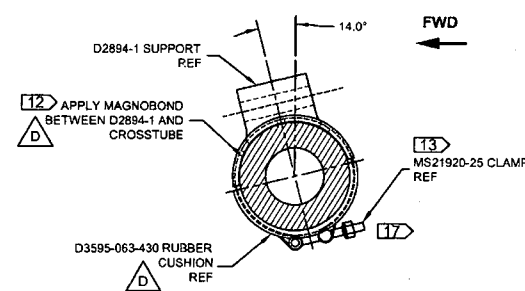

SECTION C-C
SCALE 4X

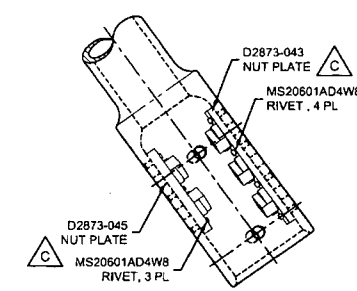

VIEW D-D CUFF DETAIL
SCALE 4X

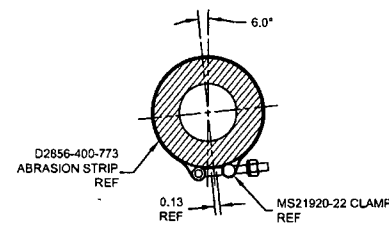

SECTION B-B
SCALE 4X, 2PL

**DEO ATTACHED
RELEASED**

DESIGN	90	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	4	DRAWING NO.	REV. F
MFG. APPR.	E	D407-667-245	SHEET 2 OF 4
APPROVED	4	TITLE	SCALE
DE APPR.	4	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

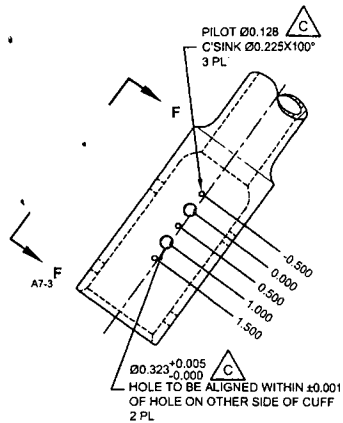

DETAIL E
SCALE 4X
(VIEW LOOKING FWD)

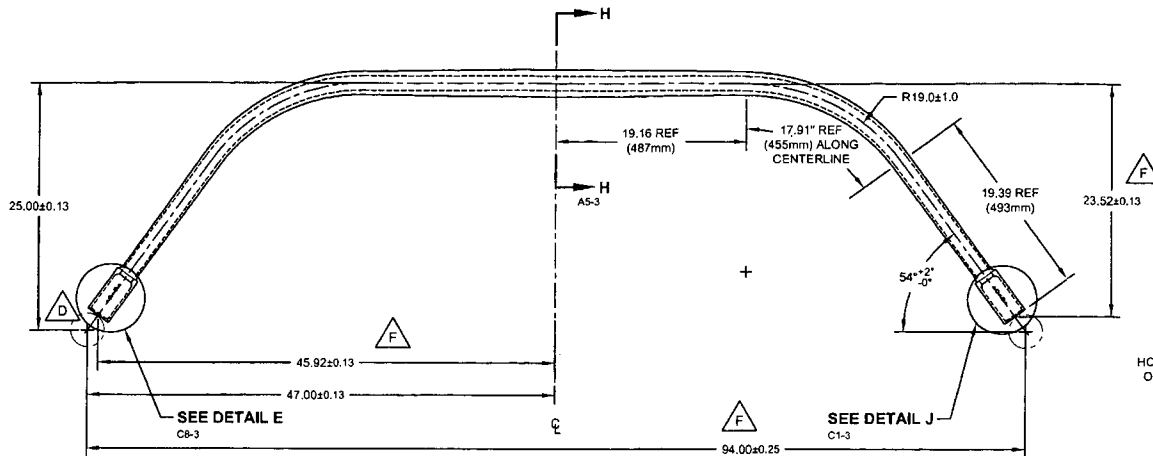


D407-667-605
BENDING AND DRILLING DETAIL
(VIEW LOOKING FWD)

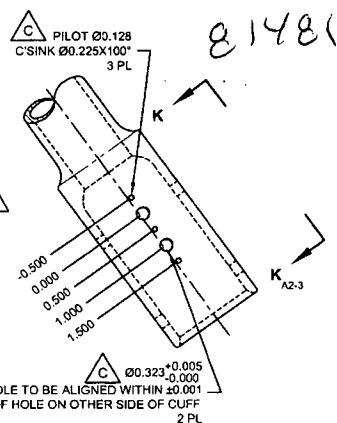


DETAIL J
SCALE 4X
(VIEW LOOKING FWD)


DEO ATTACHED RELEASED

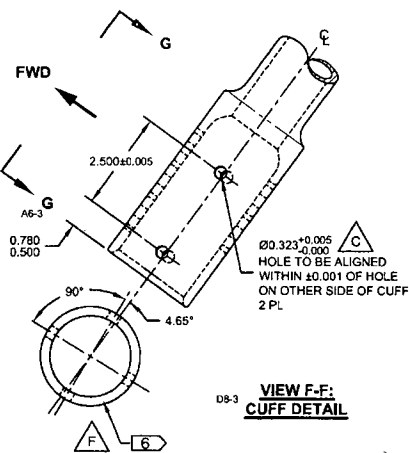


VIEW F-F:
CUFF DETAIL

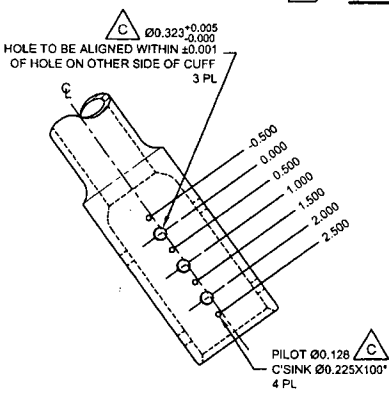


VIEW G-G
(VIEW LOOKING AFT, ROTATED)

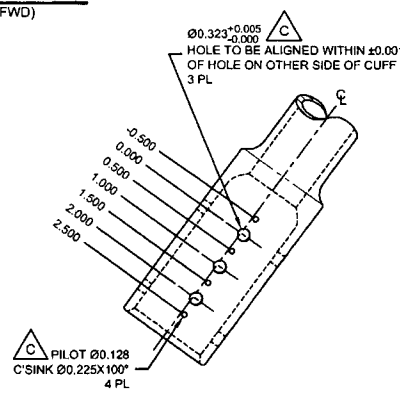

VIEW L-L
(VIEW LOOKING AFT, ROTATED)

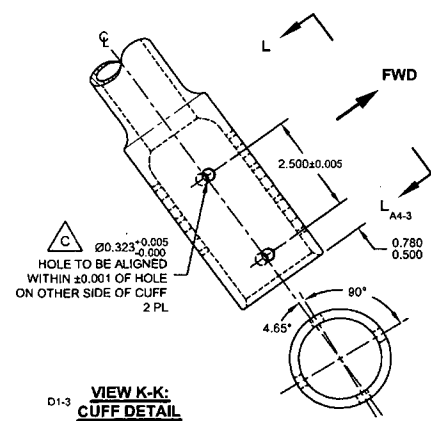

VIEW K-K:
CUFF DETAIL

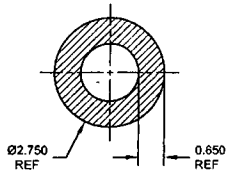

SECTION H-H
SCALE 4X

DESIGN	40	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. F
MFG. APPR.	40	D407-667-245	SHEET 3 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


SEE DETAIL M
A7-4

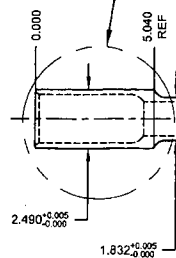


R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

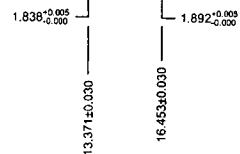

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS



R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS




SEE DETAIL P
A2-4


TAPER UNIFORMLY FROM
2.633 +0.005/-0.000 REF THROUGH TO 2.790 +0.005/-0.000 REF
RUNNING OFF PART

RELEASED
08/11/12


D407-667-245 MACHINING DETAIL

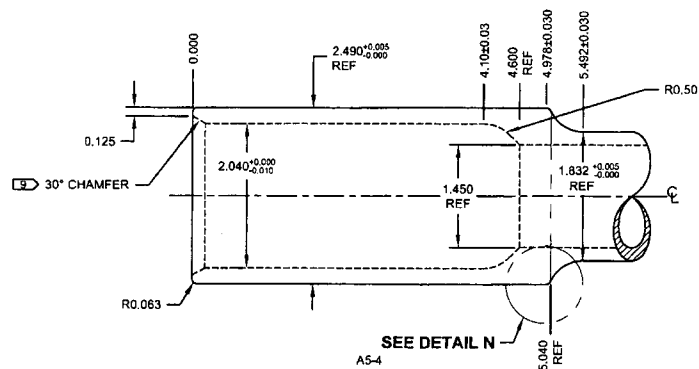

D8-4 **DETAIL M: CROSSTUBE CUFF**
SCALE 3X

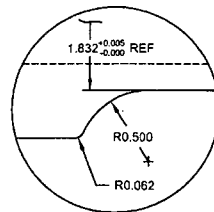

B6-4 **DETAIL N: CUFF TRANSITION**
SCALE 2X

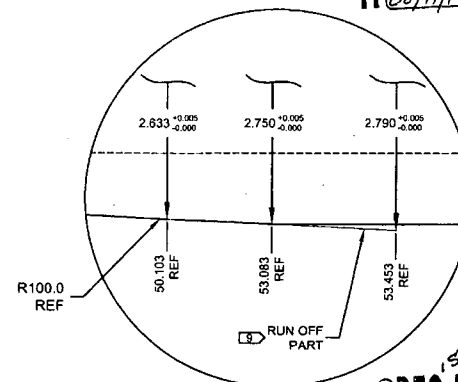

C1-4 **DETAIL P: TAPER RUN-OFF**
NOT TO SCALE

DEO ATTACHED

DESIGN	40	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	RF	D407-667-245	SHEET 4 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN <i>[Signature]</i>	CHECKED <i>[Signature]</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 11.04.08	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12		DATE 11.04.12		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -245	Part Number	Description
3	0	D2856-400-773	ABRASION STRIP

WAS:

3	2	D2856-400-773	ABRASION STRIP
---	---	---------------	----------------

NOTES 2 AND 15, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

21481
RELEASED
2011-04-18
[Signature]

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


21481

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>UP</i>	MFG. APPR. <i>E</i>	APPROVED <i>WP</i>	DE APPR. <i>H</i>		
DATE 11.04.08	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

IS:

WAS:

RELEASED
2011-04-10
WP

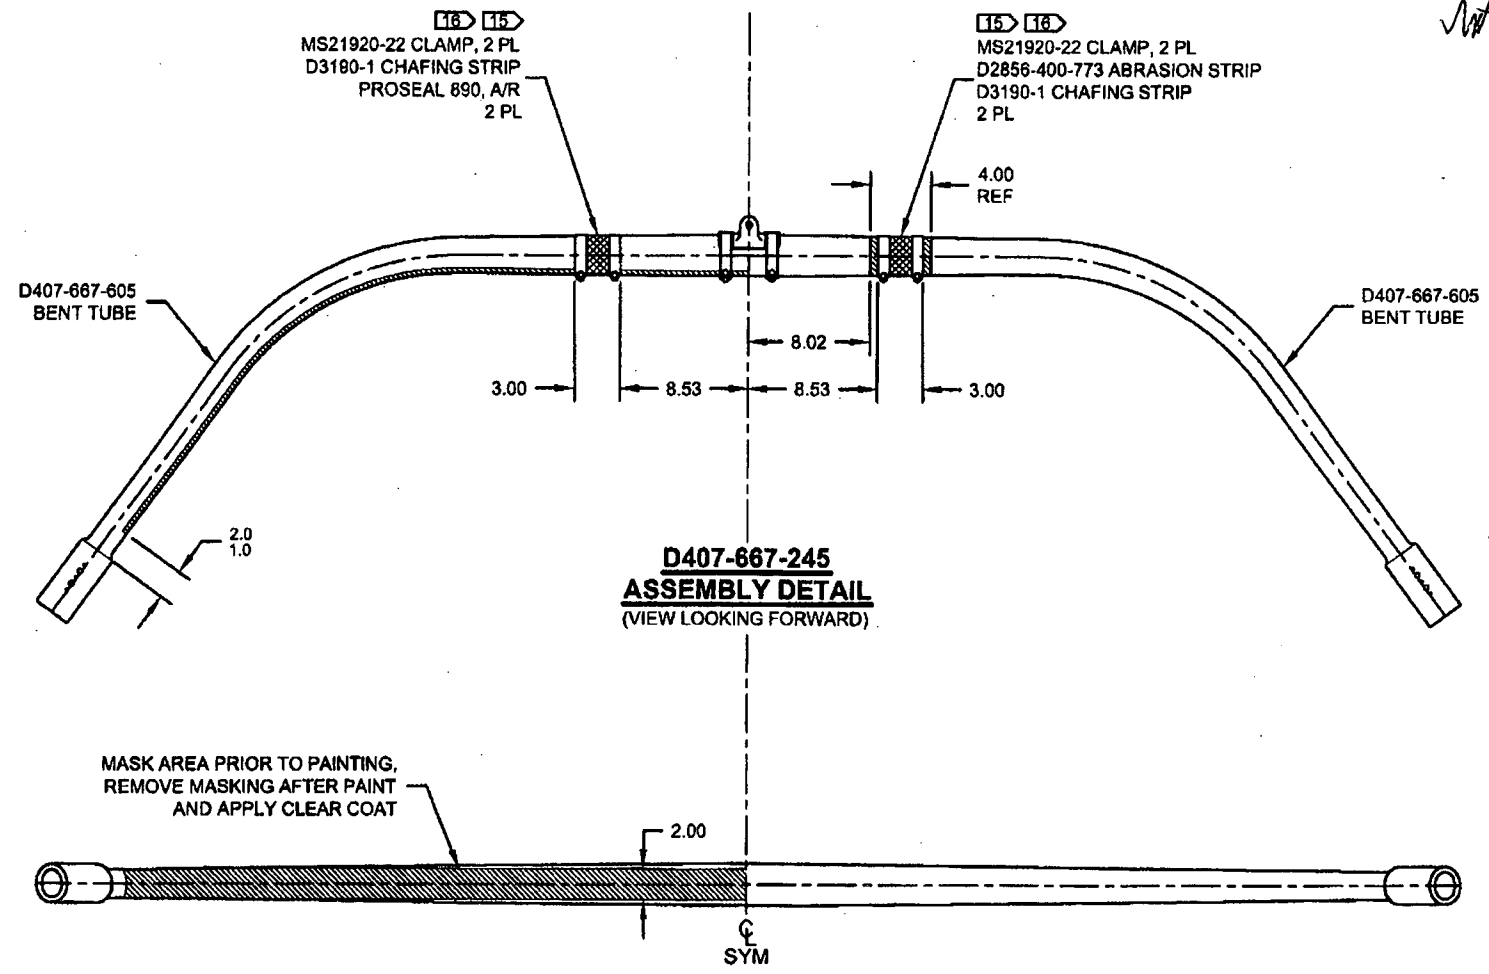

D407-667-245
ASSEMBLY DETAIL
(VIEW LOOKING FORWARD)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

21481

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>qp</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>E</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -245	Part Number	Description
12	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
----	-----	----------------	---

NOTE 12 & 17, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

WAS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



LIQUID PENETRANT TEST REPORT

P- 12178

CLIENT	DART Aerospace	DATE	03/23/2012	PAGE	1	OF	1
ATTENTION	LINDA LACELLE	ACUREN JOB No.	188-12-C0072	TIME	AM	PM	
ADDRESS	1770 ABERDEEN ST. HAWKESBURY ON.	PO/VO No.					
		WORK LOCATION	SALE				
		ACCEPTANCE STD.	ASTM 1417/01-08	REV./DATE	2008		
PROJECT	F.P.I. ON CROSS TUBES						
ITEM(S) EXAMINED	(9)						

JOB DESCRIPTION	PROCEDURE No. LT-412	REV./DATE	2008	TECHNIQUE No. LT-412	REV./DATE	2008
PART No.	SEE RESULTS	MATERIAL	ALUMINE ALUMINUM	THICKNESS	VARIOUS	
SCOPE	A WET FLUORESCENT LIQUID PENETRANT INSPECTION WAS CARRIED OUT ON 100% EXTERNAL SURFACE					

TEST DETAILS	
METHOD	<input checked="" type="checkbox"/> FLUORESCENT <input type="checkbox"/> VISIBLE
FAMILY BRAND	NASNA FLUX
PENETRANT	2667 MINIMUM DWELL TIME 450 MIN.
PENETRANT REMOVER	A70 MINIMUM DRY TIME >10 MIN.
DEVELOPER	SK052 MINIMUM DWELL TIME 10 MIN.
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS <input type="checkbox"/> AQUEOUS <input type="checkbox"/> DRY
<input checked="" type="checkbox"/> WATER WASH <input type="checkbox"/> SOLVENT REMOVABLE <input type="checkbox"/> POST EMULSIFIED	
BLACK LIGHT S/N 16459 <input type="checkbox"/> OUTPUT > 1000 μ W/cm ² <input type="checkbox"/> AMBIENT < 2 fc	
LIGHTING EQUIP. <input type="checkbox"/> FLASHLIGHT <input type="checkbox"/> TROUBLELIGHT <input type="checkbox"/> OUTPUT > 100 fc @ SURFACE	
OTHER	
LIGHT METER S/N 1098866 CAL DUE DATE JUL 978	
2012	

TEST SURFACE	
SURFACE CONDITION	<input type="checkbox"/> AS GROUND <input checked="" type="checkbox"/> AS WELDED <input type="checkbox"/> MACHINED <input type="checkbox"/> SHOT BLASTED <input type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < -4°C/20°F <input type="checkbox"/> -4°C/20°F TO 10°C/50°F <input checked="" type="checkbox"/> 10°C/50°F TO 52°C/125°F <input type="checkbox"/> > 52°C/125°F

RESULTS- <input checked="" type="checkbox"/> METRIC <input type="checkbox"/> IMPERIAL	
CROSS TUBES	
1	W.O.# 78700 ✓
1	" " 78699 ✓
1	" " 81480 ✓
1	" " 81480 ✓
1	" " 81790 ✓
1	" " 79790 ✓
1	" " 79842 ✓
1	" " 81791 ✓
A RESKIND AREA ()	
S1763/26	

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES	
CLIENT REPRESENTATIVE	Andrew Sheldon
TECHNICIAN (SIGNATURE):	Mike Johnston
NAME (PRINT):	1 st TECHNICIAN
CGSB LEVEL	SNT LEVEL
CGSB REG. No	6606
2 nd TECHNICIAN	
CGSB LEVEL	SNT LEVEL
CGSB REG. No	
DTR #	EG 3476
REPORT REVIEWED BY:	
NAME	INITIALS

5.0 PARTS LIST

5.1 HIGH GEAR CROSSTUBES

Item	Qty -101	Qty -201	Qty -103	Qty -203	Qty -105	Qty -205	Part Number	Description
	X					✓	D206-667-101	CROSSTUBE INSTALLATION, 206A/B HIGH FWD
		X					D206-667-201	CROSSTUBE INSTALLATION, 206A/B HIGH AFT
			X				D206-667-103	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH FWD
				X			D206-667-203	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH AFT
					X		D407-667-105	CROSSTUBE INSTALLATION, 407 HIGH FWD
						X	D407-667-205	CROSSTUBE INSTALLATION, 407 HIGH AFT
1	1						D206-667-141	CROSSTUBE ASSEMBLY, 206A/B HIGH FWD
2		1					D206-667-241	CROSSTUBE ASSEMBLY, 206A/B HIGH AFT
3			1				D206-667-143	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH FWD
4				1			D206-667-243	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH AFT
5					1		D407-667-145	CROSSTUBE ASSEMBLY, 407 HIGH FWD
6						1	D407-667-245	CROSSTUBE ASSEMBLY, 407 HIGH AFT
10	*2	*2	*2		*2		D2891-1	SUPPORT
11				*2			D2892-1	SUPPORT
12						*1	D2894-1	SUPPORT
13	*4	*4	*4		*4		D3595-063-395	RUBBER CUSHION
14				*4			D3595-063-450	RUBBER CUSHION
15						*2	D3595-075-430	RUBBER CUSHION
16	*4	*4	*4		*4		MS21920-20	CLAMP
17				*4		*4	MS21920-22	CLAMP
18						*2	MS21920-25	CLAMP (OR MS21920-24)
19	4	4	4		4		AN5-32A	BOLT
20				4		4	AN5-34A	BOLT
21	4	4	4	4	4	4	MS21042L5	NUT (OR MS21042-5)
22	8	8	8	8	8	8	NAS1149C0563J	WASHER (OR AN960JD516)
23						*2	D3190-1	CHAFING SHIELD
40	*2		*2	*2	*2	*2	D2873-043	NUT PLATE
41	*2		*2	*2	*2	*2	D2873-045	NUT PLATE
42		2					D2872-043	NUT PLATE
43		2					D2872-045	NUT PLATE
44	10		10				AN5-7A	BOLT
45		10		10	10	10	AN5-10A	BOLT
46	4	10	4		4		AN5-30A	BOLT
47				4		4	AN5-32A	BOLT
48			12				AN970-4	WASHER (OPTIONAL)
49		6					MS21042L5	NUT (OR MS21042-5)
50	10	12	10	10	10	10	NAS1149C0563J	WASHER (OR AN960JD516)
60		1					D3039-3	CENTER DRILL (TOOLING, NOT INSTALLED)

*REFERENCE ONLY. PARTS ARE INCLUDED IN D206-667-141/-143/-241/-243 & D407-667-145/-245
ASSEMBLIES ABOVE

• COPYRIGHT © 2001 BY DART AEROSPACE LTD •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED
OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: D

Date: 11.05.01

Part Number D407-667-205
Description 407 AFT CROSS TUBE

[illegible]